

DAI MSB 40-085/1 DAI MSB D4-106/1 DAI MSB F4-036/1 DAI MSB 40NG-058/1 Page 1 of 3 20-Nov-2018

MANDATORY SERVICE BULLETIN

MSB 40-085/1 MSB D4-106/1 MSB F4-036/1 MSB 40NG-058/1

Supersedes MSB 40-085, MSB D4-106, MSB F4-036, and MSB 40NG-058

I <u>TECHNICAL DETAILS</u>

I.1 Category

Mandatory.

I.2 Airplanes affected

Type: DA 40, DA 40 D, DA 40 F, DA 40 NG

All aircraft with Milled Rudder Pedal Assemblies:

(P/N DA4-2723-31-00 02)

I.3 Date of Effectivity

20-Nov-2018

I.4 <u>Time of Compliance</u>

Within 100 flight hours or within 1 year from the date of effectivity, whichever is reached first.

I.5 Subject

Removal of the pilot side gust lock mount.

ATA-Code: 27-20

I.6 Reason

During production check-out and subsequent investigation, on two airplanes it was noticed that with the adjustable rudder pedals in full forward position, the gust lock mounts slightly touch the canopy gas spring damper, which may cause a slight reduction in available rudder travel. The reason on this two particular airplanes was an unfavorable combination of production tolerances and it cannot be excluded that other airplanes of the same build status are also affected. Therefore this Service Bulletin prescribes removing of the gust lock mounts on the pilot side rudder pedals to ensure sufficient clearance regardless of production tolerances and rudder pedal position.

I.7 Concurrent Documents

None.



DAI MSB 40-085/1 DAI MSB D4-106/1 DAI MSB F4-036/1 DAI MSB 40NG-058/1 Page 2 of 3 20-Nov-2018

I.8 Approval

The technical information or instructions contained in this document relate to the Design Change Advisory No. MÄM 40-1020, which is approved as part of the Type Design.

I.9 Accomplishments / Instructions

Comply with WI-MSB 40-085 / WI-MSB D4-0106 / WI-MSB F4-036 / WI-MSB 40NG-058, latest effective issue.

I.10 Mass (Weight) and CG

Negligible.

II PLANNING INFORMATION

II.1 Material and Availability

See WI-MSB 40-085 / WI-MSB D4-0106 / WI-MSB F4-036 / WI-MSB 40NG-058, latest effective issue.

II.2 Special Tools

None.

II.3 Labour Effort

Approx. 0.5 hours.

II.4 Credit

None.

II.5 Reference Documents

Diamond Aircraft 40 Series Airplane Maintenance Manual, Doc. No. 6.02.01, latest effective issue.

Diamond Aircraft 40 NG Airplane Maintenance Manual, Doc. No. 6.02.15, latest effective issue.

Diamond Aircraft Airplane Flight Manual, Doc. No. 6.01.01 / 6.01.02 / 6.01.05 / 6.01.15, Temporary Revision TR-MÄM-40-1020.

III <u>REMARKS</u>

- 1. All work must be done by a certified aircraft service station or a certified aircraft maintenance mechanic.
- 2. All work, particular that which is not especially described in this Service Bulletin, must be done in accordance with the referenced Maintenance Manual.
- 3. Completion of all work must be recorded in the log book.
- 4. In case of doubt contact Diamond Aircraft Industries Canada.



DAI MSB 40-085/1 DAI MSB D4-106/1 DAI MSB F4-036/1 DAI MSB 40NG-058/1 Page 3 of 3 20-Nov-2018

EXECUTION REPORT TO SERVICE BULLETIN MSB ____

AIRPLANE INFORMATION			
Airplane Serial Number			
Airplane Registration			
Airplane Operator			
Hours of operation of airplane			
Typical operation of airplane	private, club, traini	ing, other	
Date, Name, Sign			

Please email the completed form to techpubs@diamondair.com.



DAI WI-MSB 40-085 DAI WI-MSB D4-106 DAI WI-MSB F4-036 DAI WI-MSB 40NG-058 Page 1 of 3 13-Nov-2018

WORK INSTRUCTION
WI-MSB 40-085
WI-MSB D4-106
WI-MSB F4-036
WI-MSB 40NG-058

I GENERAL INFORMATION

I.1 Subject

Removal of pilot side gust lock mounts from rudder pedals.

I.2 Reference Documents

Diamond Aircraft 40 Series Airplane Maintenance Manual, Doc. No. 6.02.01, latest effective issue.

Diamond Aircraft 40 NG Airplane Maintenance Manual, Doc. No. 6.02.15, latest effective issue.

I.3 Remarks

All work must be done by a certified aircraft service station or a certified aircraft maintenance mechanic.

All work, in particular if not described in this work instruction, must be done in accordance with the referenced maintenance manual.

For conversion factors between SI units and US/Imperial units refer to AMM Chapter 02.

In case of doubt, contact Diamond Aircraft Industries Inc.

II <u>DRAWINGS, SPECIAL TOOLS & MATERIALS</u>

II.1 **Drawings**

None.

II.2 Special Tools

None.



DAI WI-MSB 40-085 DAI WI-MSB D4-106 DAI WI-MSB F4-036 DAI WI-MSB 40NG-058 Page 2 of 3 13-Nov-2018

II.3 Material

Quantity	Part Number	Description
2	MS 171532	Pin-Spring

Material is available from Diamond Aircraft Industries.

III INSTRUCTIONS

- Position the pilot electrical or mechanical rudder pedal full rearward.

 Remove the spring pin from the LH and RH Pilot rudder pedal with a 3mm punch with a centering pin (see picture 1). Make sure that the spring pin does not collide with the washer.
- Remove the spring pin from the LH and RH Pilot rudder pedal with a 3mm punch with a centering pin (see picture 1). Make sure that the spring pin does not collide with the washer with hole (see picture 2).



Picture 1



DAI WI-MSB 40-085 DAI WI-MSB D4-106 DAI WI-MSB F4-036 DAI WI-MSB 40NG-058 Page 3 of 3 13-Nov-2018



- Picture 2
- Remove the gust lock mounts from the rudder pedals. 3
- 4 Install the new spring pins into the LH and RH Pilot rudder pedal.
- 5 Prepare the gust lock belt in accordance with picture 3 for use on the Co-Pilot rudder pedals.

Note: the gust lock mounts on the Co-Pilot rudder pedals are already installed. Refer also to the Airplane Flight Manual Temporary Revision TR-MÄM 40-1020.



70cm (27.56in) Band length

- 6 Incorporate TR-MÄM 40-1020 into the Airplane Flight Manual according to instructions given on the cover sheet of the TR-MÄM 40-1020.
- 7 Make all necessary entries in the airplane logs.