

SERVICE INFORMATION NO. SI-42-142

NOTE: SI's are used only:
1) To distribute information from DAI to our customers.
2) To distribute applicable information/documents from our suppliers to our customers with additional information.
Typically there is no revision service for SI's. Each new information or change of that will be sent along with a new SI.

I. TECHNICAL DETAILS

1.1 Airplanes affected:

All DA 42 and DA 42 M aircraft with G1000 system software version 0370.22 are affected.

1.2 Subject:

GARMIN Service Bulletin No. 1032, Revision A
ATA-Code: 34-00

1.3 Reason:

The Service Bulletin No. 1032, Revision A provides instructions for the activation of Synthetic Vision & Pathway options for the GARMIN G1000 System.

1.4 Information:

For detailed technical information refer to the GARMIN Service Bulletin No. 1032, Revision A.

The temporary AFM revision TR-OÄM 42-146/a must be incorporated into the Airplane Flight Manual Doc. No. 7.01.05-E, or into the Airplane Flight Manual Doc. No. 7.01.06-E, or the AFM revision, in which this temporary revision has been incorporated to must be used.

The Supplement to AFM S06 Rev. 0 must be included in the AFM.

II. OTHERS

The GARMIN Software Service Bulletin No. 1032, Revision A is attached to this SI.

In case of doubt contact Diamond Aircraft Industries GmbH.



SERVICE BULLETIN

NO.: 1032 Revision A

TO: Diamond Aircraft Industries, Inc
DATE: 24 August, 2010
SUBJECT: G1000 Synthetic Vision & Pathways Activation, Diamond DA 42

PURPOSE

This Service Bulletin announces the availability of the G1000 Synthetic Vision & Pathways option.

DESCRIPTION

This Service Bulletin provides information required to activate Synthetic Vision & Pathways on G1000-equipped Diamond DA42 with G1000 System Software Version 0370.22 and later.

NOTE

The G1000 Synthetic Vision & Pathways feature is not available with G1000 System Software Versions prior to 0370.22. Refer to Garmin Service Bulletin 1031 for information on upgrading to G1000 System Software Version 0370.22.

APPROVAL

The engineering data contained in this software service bulletin are FAA approved. This bulletin does not provide installation authorization.

For approved configurations refer to the Diamond Aircraft MSB42-008, latest version.

© Copyright 2010
Garmin Ltd. or its subsidiaries
All Rights Reserved

Except as expressly provided herein, no part of this document may be reproduced, copied, transmitted, disseminated, downloaded or stored in any storage medium, for any purpose without the express prior written consent of Garmin. Garmin hereby grants permission to download a single copy of this document and of any revision to this document onto a hard drive or other electronic storage medium to be viewed and to print one copy of this document or of any revision hereto, provided that such electronic or printed copy of this document or revision must contain the complete text of this copyright notice and provided further that any unauthorized commercial distribution of this document or any revision hereto is strictly prohibited.

AFMS AND PILOT'S GUIDE CONSIDERATIONS

Flight Manual documentation as required per Diamond Aircraft.

The following documents describe operation of the Garmin G1000:

Garmin Part Number	Document Title
190-00406-07	G1000 Cockpit Reference Guide for the Diamond DA42
190-00649-03	G1000 Pilot's Guide for the Diamond DA42

PRODUCT AFFECTED

All G1000-equipped Diamond DA42 aircraft with G1000 System Software Version 0370.22 or later.

NOTE

The G1000 Synthetic Vision & Pathways feature is not available with G1000 System Software Versions prior to 0370.22. Refer to Garmin Service Bulletin 1031 for information on upgrading to G1000 System Software Version 0370.22.

COMPLIANCE

Compliance with this service bulletin is optional.

WARRANTY INFORMATION

This modification is not warranty reimbursable.

MODIFICATION INSTRUCTIONS

This section provides the requirements and instructions necessary to unlock the G1000 Synthetic Vision/Pathways feature.

Baseline Software:

G1000 System Software Version 0370.22 is required to be installed prior to starting this procedure. Refer to Garmin Software Service Bulletin 1031 for information on upgrading to G1000 System Software Version 0370.22.

Database Cards:

Each G1000 display must be equipped with a Terrain/Obstacle/SafeTaxi database card (010-00330-43) installed in the lower slot.

SVS/Pathways Unlock Card:

A Synthetic Vision & Pathways unlock card (010-00330-54) is required to activate the SVS/Pathways feature for G1000/DA42 installations.

NOTE

When the SVS/Pathways option is enabled for the first time, the G1000 writes its unique system ID to the physical card and locks the files to this unique ID. This prevents the SVS/Pathways unlock card from ever being used to activate the SVS/Pathway feature in other G1000 systems.

The unlock card is forever tied to the specific aircraft in which it was used for the first time. This card **MUST** be kept with the aircraft for situations where SVS/Pathways must be re-activated.

SVS Activation Procedure:

Activate the SVS/Pathways feature by performing the following steps:

1. Pull the MFD and PFD circuit breakers.
2. Remove and discard the 010-00330-41 or 010-00330-42 terrain cards from the bottom card slot of the PFD and MFD.
3. Turn on the ground power unit, if used.
4. Turn on the Electrical Master Switch.
5. Turn on the Avionics Master switch. At this moment, all G1000 equipment should be receiving power, except the PFD and MFD.
6. Insert the Synthetic Vision & Pathways unlock card (010-00330-54) in the upper slot of the PFD.
7. While holding the ENT key on the MFD, restore power by closing the MFD circuit breaker.
8. When the words **INITIALIZING SYSTEM** appear in the upper left corner of the MFD, release the ENT key.
9. Repeat Steps 7 and 8 for the PFD.
10. On the PFD, go to the System Upload page using the FMS knob.
11. Activate the cursor.
12. Use the small FMS knob to select "CONFIGURATION FILES" in the AIRFRAME field.
13. Press the ENT key.
14. Use the small FMS knob to select the "Enable SVS Single PFD" option in the FILE field.
15. Press the ENT key.
16. Once the option is selected the configuration files in the PRODUCT field will be displayed. All files should be checked. If not, press the CHK ALL softkey.
17. Press the LOAD softkey.
18. Monitor the status of the upload. When the upload is finished, press the ENT key to acknowledge the upload complete confirmation.
19. View the SUMMARY field and ensure that the item is 'COMPLETED'.
20. Power down the system and remove the SVS Unlock card from the PFD.
21. Insert the new 010-00330-43 terrain cards into the bottom card slot of the PFD and MFD.

TESTING PROCEDURE

1. Apply power to the G1000 system. Allow the AHRS and magnetometer systems to stabilize and align. Verify that air data information becomes valid on the PFD.
2. Check the MFD AUX – GPS Status page to verify a 3D GPS signal acquisition.
3. Press the ALERTS softkey on the PFD and verify no database, manifest, or configuration errors exist.
4. Press the PFD softkey. Verify a SYN VIS softkey is shown in the lower left corner of the display.
5. Press the SYN VIS softkey, then press the SYN TERR softkey, to activate the Synthetic Vision terrain display feature. Verify that the traditional blue/brown attitude depiction is replaced with the Synthetic Vision rendering within 2-3 minutes of activation (with a 3D GPS signal acquisition).
6. Installation is complete. Be sure to keep the SVS/Pathways unlock card with the aircraft for future use.

MATERIAL INFORMATION

QTY	Part Number	Description
1	010-00330-54	Synthetic Vision & Pathways Unlock, 1 PFD
2*	010-00330-43	SD Supplemental Data Cards
1	190-00406-07	G1000 Cockpit Reference Guide for the Diamond DA42
1	190-00649-03	G1000 Pilot's Guide for the Diamond DA42

*Required if not already installed.

ADDITIONAL INFORMATION

Garmin recommends that the installer and owner/operator review the service documents listed at www.garmin.com for applicable Service Alerts and Service Advisories relevant to the functions installed per this bulletin.