

Hoffmann Aircraft Ges.m.b.H.  
Richard Neutra Gasse 5  
A-1214 W i e n

Service - Bulletin 15/2  
=====

Affected: All SNo's of sample H 36 "Dimona"

Subject: Horizontal tail surfaces mounting in front.

Occasion: Possible cracking in the rod end bearing.

Actions: 1.) The front HTS-mounting (rod end bearing SMXCP 10 M) is to check for crackings in the thread and in the area of the thread end. (magnifier !).  
Check securing nut for fixing.  
2.) A modified rod end bearing Hirschmann "SMXC 10 special design" is to mount according to work instruction No. 7.

Urgency: Action 1: before next flight.  
Action 2: after execution of action 1,  
within the next 50 operating hours.

Weight and balance: Not affected.

Remarks: Action 1 can be done by a competent person.  
Action 2 must be done by an authorized aircraft maintenance mechanic and attested in the logbook.

Vienna, 20th of January 1987

  
Dipl.-Ing. O. Seidler