

SERVICE BULLETIN



Service Bulletin No.: DAC1-92-03, Rev. 0

Date Issued: 28 February 2007

Title: Certification, Mexican Import Requirements

Page: 1 of 5

- 1. ATA Code:** 9200
- 2. Effectivity:** All DA 20 C1 Aircraft, S/N 0150 and subsequent, for operation under Mexican registry.
- 3. General:** This bulletin describes modifications required for aircraft operating under Mexican registry.
- 4. Compliance:** Prior to operation in Mexico.
- 5. Approval:** Data referenced or contained in this service bulletin is Ministerio De Fomento approved.

- 6. Labor:** Approximately 1 hour will be required to accomplish this service bulletin.
This estimate is for direct labor performed by a technician and it does not include setup, planning, familiarization, cure time, part fabrication or tool acquisition.

7. Material:	Part	Description	Qty
	22-1120-03-01	Placard, Spanish, Canopy Locking	1
	22-1120-03-19	Placard, Spanish, Canopy Latching (LH)	1
	22-1120-03-20	Placard, Spanish, Canopy Latching (RH)	1
	22-1130-03-05	Placard, Spanish, Emergency Hammer	1
	22-1130-03-12	Placard, Spanish, Baggage	1
	22-1130-03-20	Placard, Spanish, Fuel Pull-Off	1
	22-1130-03-31	Placard, Spanish, Canopy Latching (LH)	1
	22-1130-03-32	Placard, Spanish, Canopy Latching (RH)	1

The above material may be ordered as kit DA22-92-03 AMK0

- 8. Special Tools:** No special tools are required.
- 9. References:** No additional references are required.

SERVICE BULLETIN



Service Bulletin No.: DAC1-92-03, Rev. 0


Date Issued: 28 February 2007

Title: Certification, Mexican Import Requirements

Page: 2 of 5


10. Accomplishment Instructions:

- 10.1** Replace the English language placards with the Spanish language placards as shown in Figures 1 through 5. Refer to Aircraft Maintenance Manual DA201-C1 for the instructions to remove and re-install the canopy lock and canopy handles.

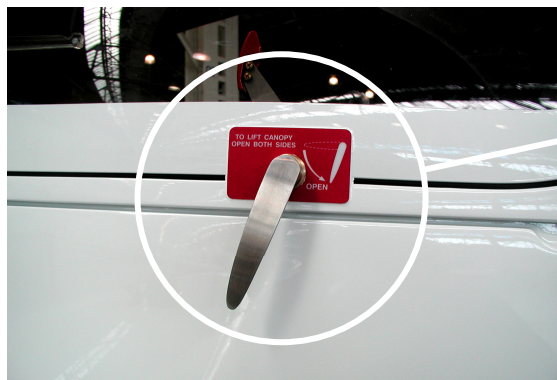


22-1120-03-20

Right Side - Exterior Canopy Frame

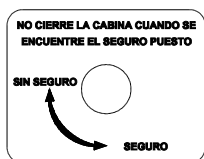

22-1120-03-01

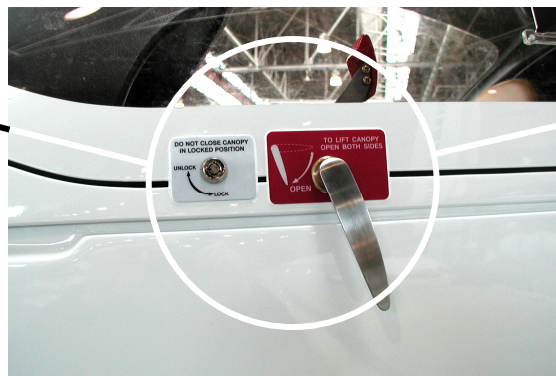

22-1120-03-19

Left Side - Exterior Canopy Frame

Figure 1
Exterior Canopy Placards Installation

SERVICE BULLETIN




Service Bulletin No.: DA20-92-02, Rev. 0

Date Issued: 28 February 2007


Title: Certification, Spanish Import Requirements

Page: 3 of 5

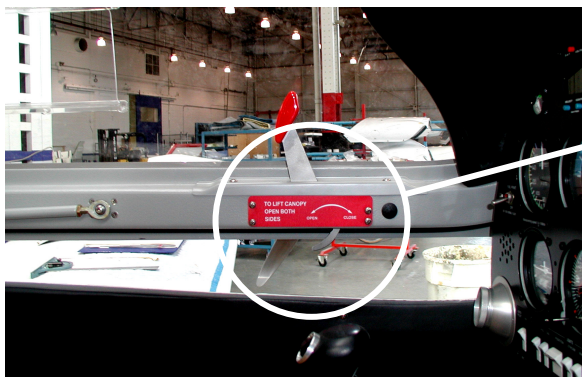

22-1130-03-31

Left Side - Interior Canopy Frame

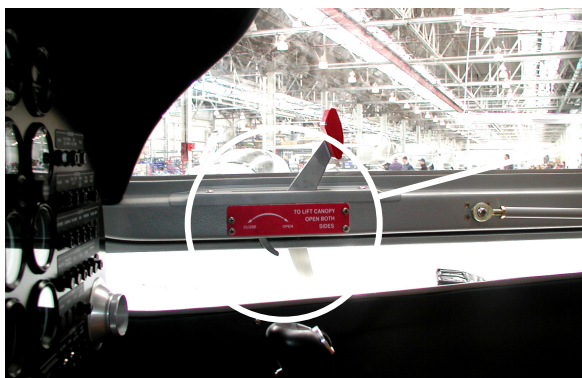

22-1130-03-32

Right Side - Interior Canopy Frame

Figure 2
Interior Canopy Placards Installation

SERVICE BULLETIN



Service Bulletin No.: DA20-92-02, Rev. 0

Date Issued: 28 February 2007

Title: Certification, Spanish Import Requirements

Page: 4 of 5




22-1130-03-20

Figure 3
Fuel Pull-Off Placard Installation



22-1130-03-05

Figure 4
Rescue Hammer Placard Installation

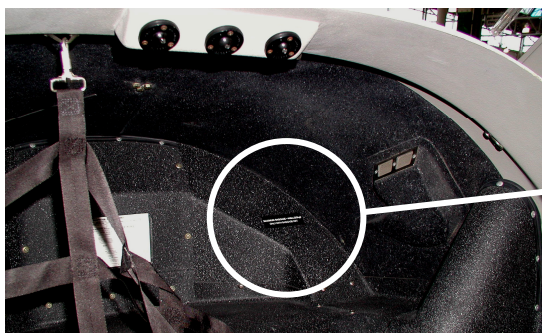

**CAPACIDAD MÁXIMA
EN EQUIPAJE - 44 lbs (20kg)**
SOLO CON RED PARA EQUIPAJE

22-1130-03-12

Figure 5
Baggage Placard Installation

SERVICE BULLETIN



Service Bulletin No.: DA20-92-02, Rev. 0

Date Issued: 28 February 2007

Title: Certification, Spanish Import Requirements

Page: 5 of 5

11. Weight and Balance: The incorporation of these placards has a negligible effect on the weight and balance of the aircraft.

12. Availability: Contact Diamond Aircraft Parts Department

To obtain satisfactory results, procedures specified in this Service Bulletin must be accomplished in accordance with accepted methods and current government regulations. Diamond Aircraft Industries Inc. cannot be responsible for the quality of work performed in accomplishing the requirements of this Service Bulletin. Diamond Aircraft reserves the right to void continued warranty coverage in the area affected by this Service Bulletin if it is not incorporated.
If you no longer own the aircraft to which this Service Bulletin applies, please forward it to the current owner and send the name of the current owner to Diamond Aircraft Industries Inc., at the address below.

Diamond Aircraft Industries Inc. 1560 Crumlin Road, London, Ontario, Canada N5V 1S2
Phone: (519) 457-4041 Fax: (519) 457-4060

COPYRIGHT 2007