

---

## SERVICE INFORMATION LETTER NO. SI40NG-066

NOTE: Service Information Letters are used only:

1. To distribute information from Diamond Aircraft Industries Inc. to our customers.
2. To distribute applicable information/documents from our suppliers to our customers with additional information.

NOTE: Typically there is no revision service for Service Information Letter (SIL). Each new information or change will be sent along with a new SIL.

### 1. TECHNICAL DETAILS

#### 1.1 Aircraft Affected

All DA40NG airplanes

#### 1.2 Subject

Air Filter

ATA-Code: 71-60

#### 1.3 Reason


In the aircraft assembly, line residue from manufacturing of the air filter was found in the charged air system.

#### 1.4 Information

Diamond Aircraft Industries Inc. advises maintenance personnel to inspect the bag in which new air filters are delivered and inspect also the inside of new air filters for loose residue from manufacturing.

### CAUTION

Undetected residue may enter the charged air system and damage the turbocharger.

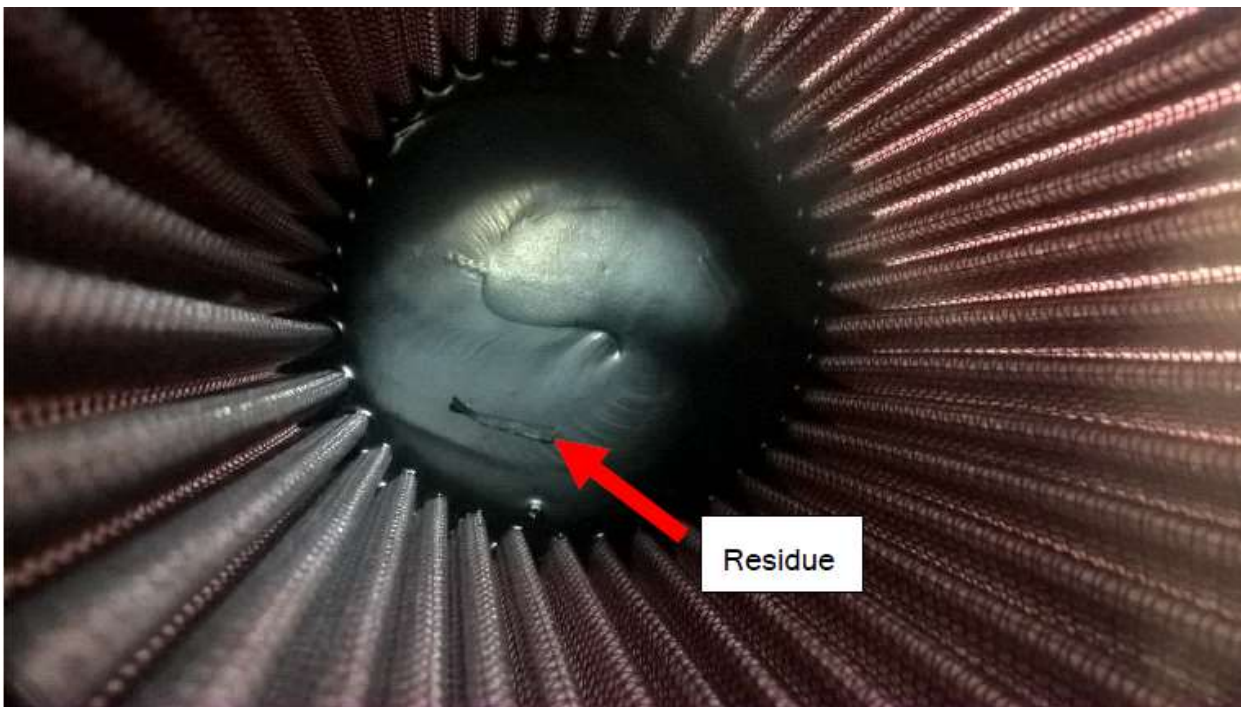

If loose residue is detected, remove it carefully prior to installation of the air filter.

If there is any doubt that the removal of the residue will affect the filter function or all residue cannot be removed, replace the air filter with a new air filter.

## 2. OTHERS

In case of doubt contact Diamond Aircraft Industries.