

## SERVICE INFORMATION LETTER NO. SI62-043

NOTE: Service Information Letters are used only:

1. To distribute information from Diamond Aircraft Industries Inc. to our customers.
2. To distribute applicable information/documents from our suppliers to our customers with additional information.

NOTE: Typically there is no revision service for Service Information Letter (SIL). Each new information or change will be sent along with a new SIL.

### 1. TECHNICAL DETAILS

#### 1.1 Aircraft Affected

Aircraft: DA 62.

S/N: 62.C054 and prior.

#### 1.2 Subject

Improved Routing of Cabin Heat Bowden Cable.

ATA-Code: 21-60

#### 1.3 Reason

The purpose of this Service Information Letter is to inform owners and operators about the improved routing of the RH engine cabin heat bowden cable. This new routing prevents the cable from moving and touching the crank pulley, which can damage the cabin heat bowden cable.

#### 1.4 Information

1. Locate the cabin heat bowden cable and proceed to the next recommended step.
2. Secure the RH engine cabin heat bowden cable to the wiring harness using standoff cable tie mounts and cable ties. Refer to Figure 1.

NOTE: Make sure that the cabin heat bowden cable cannot touch engine belts or pulleys.

NOTE: Make sure that the cabin heat bowden cable is moving freely and reaching full open and closed positions.

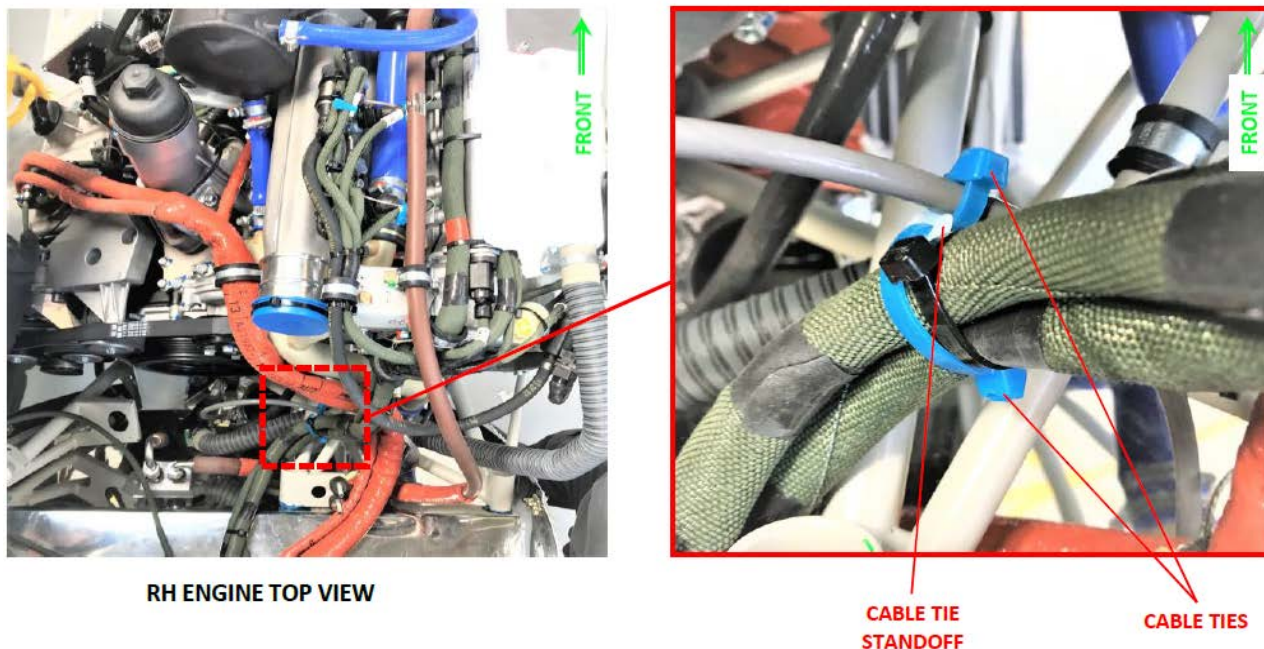


Figure 1.

## 2. OTHER DETAILS

To obtain satisfactory results, procedures specified in this service information letter must be accomplished in accordance with accepted methods and current government regulations. Diamond Aircraft Industries Inc. cannot be responsible for the quality of work performed in accomplishing the requirements of this service information letter. Diamond Aircraft reserves the right to void continued warranty coverage in the area affected by this service information letter if it is not incorporated. If you no longer own the aircraft to which this service information letter applies, please forward it to the current owner and send the name of the current owner to Diamond Aircraft Industries Inc. at the address below.

*Diamond Aircraft Industries Inc.*

# SERVICE INFORMATION LETTER

MODEL DA 62

---



Diamond Aircraft Industries Inc.  
1560 Crumlin Sideroad, London, Ontario, Canada  
N5V 1S2

Customer Support  
Phone: (519) 457-4041

Portal: <https://partners.diamondaircraft.com>

Service & Support:  
<https://www.diamondaircraft.com/en/service-and-support/service-center-locations/>