

Service Bulletin 14/2

Affected Aircraft: All SNo's of motorglider type H 36-Dimona

Subject: Elevator connection

Occasion: Possibility of mounting the horizontal fin without connecting the elevator.



Required

Action: 1.) Execution of the actions described in service bulletin 14  
2.) Fix a self adhesive badge, which shows the right connection of the elevator (sketch page 2)  
3.) Insert page 17 (section 2) into flight manual

Urgency: before next flight

Weight and balance: not affected

Remarks: The actions of this S.B. must be performed by a competent person. Action 3 has to be confirmed at page 1 (section 0) of the flight manual. This S.B. is a supplement to the S.B. No.14, approved by the BAZ on September 3rd, 1985.

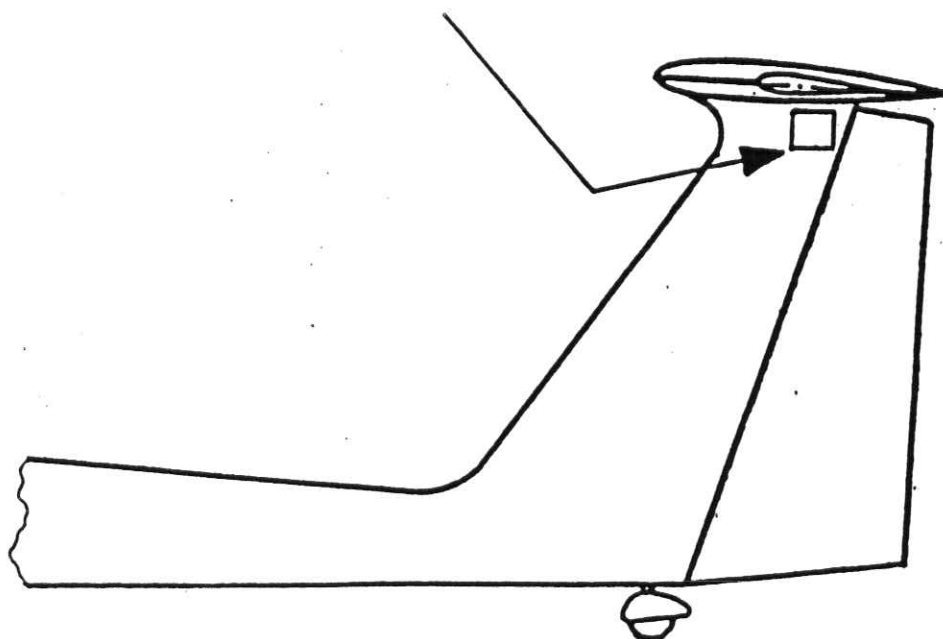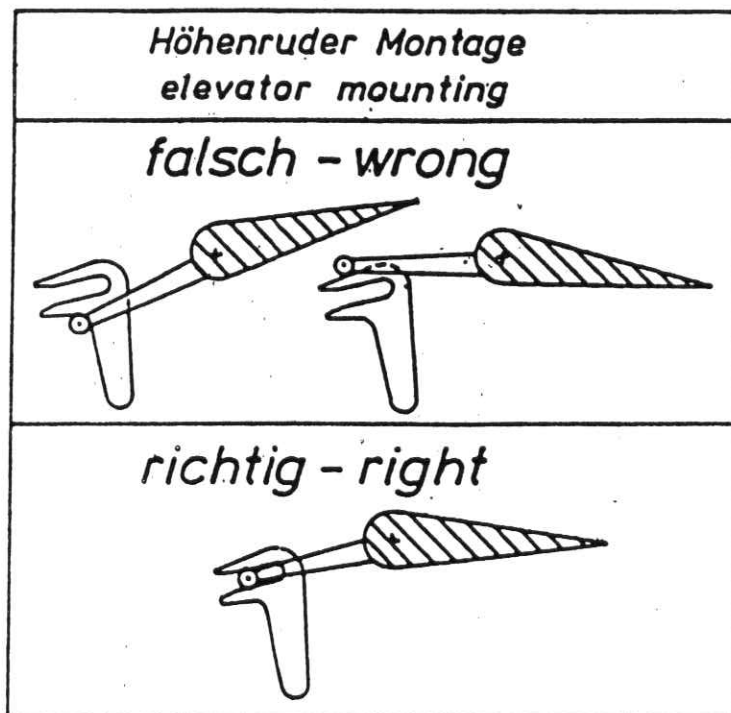

Hoffmann  
H 36 DIMONA

Limitations

OIL  
SAE 15W-40

Next to oil filler neck

Fuel  
AVGAS 100 LL or  
MOGAS SUPER (ROZ 97 OCZ)  
Fuel Capacity  
80 Ltr 21.1 US GAL

Next to Fuel filler neck

AIRBRAKE - PULL  
Wheelbrake at end of travel

On airbrake handle

Canopy Jettison

Next to Canopy Jettison handle

NO STEP

Main Wheel Fairings

NO PUSH

Ailerons, Rudder and Elevator

OPEN - CLOSED

Next to Canopy Handles

FULL - THROTTLE - IDLE

next to throttle

Tachometer indicates  
RPM to high  
to low


next to Tachometer

Before removing  
battery insulate  
Rudder cable

next to battery storage

approved aerobatic manœuvres:  
ALL AEROBATIC MANOEUVERS  
INCLUSIVE SPIN AND  
FLIGHTS IN CLOUDS  
ARE FORBIDDEN!

Below Canopy Frame  
Left Side

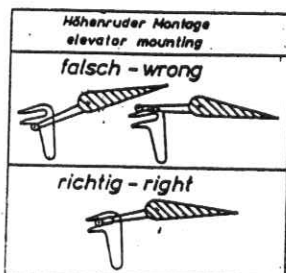

left side of vertical fin