

SERVICE INFORMATION NO. SI D4-146

NOTE: SI's are used only:
1) To distribute information from DAI to our customers.
2) To distribute applicable information/documents from our suppliers to our customers with additional information.
Typically there is no revision service for SI's. Each new information or change of that will be sent along with a new SI.

I. TECHNICAL DETAILS

1.1 Airplanes affected:

All DA 40 D equipped with GARMIN G1000

1.2 Subject:

GARMIN Software Service Bulletin No.: 0533 Revision B
ATA-Code: 34-00

1.3 Reason:

Garmin has issued the Software Service Bulletin No. 0533 Revision B which contains instructions for updating the IGRF (International Geometric Reference Frame) Magnetic Field Model from base year 2005 to 2010.

1.4 Information:

For detailed technical information see GARMIN Software Service Bulletin No.: 0533 Revision B which is applicable without any further additions or restrictions.

II. OTHERS

The GARMIN Software Service Bulletin No.: 0533 Revision B is attached to this SI.

In case of doubt contact Diamond Aircraft Industries GmbH.



SOFTWARE SERVICE BULLETIN

NO.: 0533 Rev B

TO: All Garmin Aviation Service Centers

DATE: 11 January 2011

SUBJECT: New 2010 IGRF Magnetic Field Model For All Garmin Integrated Flights Decks (G1000, G900X, G950, Cirrus Perspective, Embraer Prodigy) Equipped Aircraft

REVISION B: Updated for 2010 IGRF Magnetic Field Model

PURPOSE

This Service Bulletin contains instructions for updating the IGRF (International Geometric Reference Frame) Magnetic Field Model from base year 2005 to 2010 for systems that are unable comply with Garmin Service Advisory 1051 (2010 IGRF update as part of navigation database cycle 1013). As the earth's magnetic field is continuously changing, similar updates will become available every five years.

DESCRIPTION

This Service Bulletin requires all Garmin integrated flight deck equipped aircraft to update the IGRF Magnetic Field Model to 2010 before December 31, 2011. Failure to do so may compromise heading and attitude performance and result in an advisory message starting January 1, 2012.

AFMS AND PILOT'S GUIDE CONSIDERATIONS

There are no recommended AFMS changes.

PRODUCT AFFECTED

All Garmin integrated flight deck systems equipped with a GRS 77 AHRS containing IGRF Magnetic Field Model 2005 are affected. The IGRF Magnetic Field Model can be viewed on the System Status page in Configuration mode. For instructions on viewing the IGRF Magnetic Field Model refer to the MODIFICATION INSTRUCTIONS Section of this Service Bulletin.

© Copyright 2011
Garmin Ltd. or its subsidiaries
All Rights Reserved

Perspective™ is a trademark of Cirrus Design Corporation. Prodigy™ is a trademark of Embraer S.A. Except as expressly provided herein, no part of this document may be reproduced, copied, transmitted, disseminated, downloaded or stored in any storage medium, for any purpose without the express prior written consent of Garmin. Garmin hereby grants permission to download a single copy of this document and of any revision to this document onto a hard drive or other electronic storage medium to be viewed and to print one copy of this document or of any revision hereto, provided that such electronic or printed copy of this document or revision must contain the complete text of this copyright notice and provided further that any unauthorized commercial distribution of this document or any revision hereto is strictly prohibited.

COMPLIANCE

Compliance with this software service bulletin is recommended for the next regularly scheduled aircraft maintenance event. Completion must be accomplished prior to December 31, 2011.

REFERENCES

For general information regarding the G1000 Configuration mode see the G1000 Configuration and Line Maintenance Manual, P/N 190-00303-04, Rev. F or later.

WARRANTY INFORMATION

This modification is not warranty reimbursable.

MODIFICATION INSTRUCTIONS FOR SYSTEMS WITH GDU SOFTWARE VERSIONS LESS THAN 7.00

CAUTION

Make sure electrical power to the system is not interrupted during the update process. If electrical power is interrupted during the update process, the system may require maintenance.

With the G1000 turned off, insert the 2010 IGRF Model Update Card into the top slot of the PFD.


1. Hold the ENT key down while powering on the MFD and PFD.
2. Apply power to entire Garmin Integrated Flight Deck.
3. Press the FMS knob to activate the cursor.
4. Using the FMS knob highlight **GRS1 MV DB** in the LRU field.
5. If IGRF Part Number is 006-D0159-01 and Version is 2005.00 continue to step #6. If IGRF Part Number is 006-D0159-02 and Version is 2010.00, do not continue this procedure.




6. Press the FMS knob to deactivate the cursor.
7. Turn the small FMS knob to the Software Upload page in the System group.
8. Press the FMS knob to highlight **GRS77 IGRF – 2010 006-B0223-XX** in the File List.




9. Press the LOAD softkey.
10. Select OK and press the ENT key to acknowledge the following prompt:

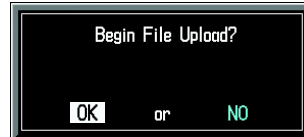

11. Monitor the upload status as it progresses:



12. After the files finish loading, press the ENT key to acknowledge the following prompt:

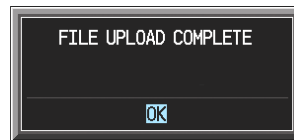

13. Press the FMS knob to deactivate the cursor.

14. Turn the small FMS knob to the System Status Page.

15. Press the FMS knob to activate the cursor.

16. Using the FMS knob highlight **GRS1 MV DB** in the LRU field.


17. Verify IGRF Part Number is 006-D0159-02 and Version is 2010.00.

MODIFICATION INSTRUCTIONS FOR SYSTEMS WITH GDU SOFTWARE VERSIONS 7.00 AND GREATER

CAUTION

Make sure electrical power to the system is not interrupted during the update process. If electrical power is interrupted during the update process, the system may require maintenance.

1. Insert the 2010 IGRF Model Update Card into the top slot of PFD 1.
2. Hold the ENT key down while powering on the MFD and PFD(s).
3. Apply power to entire Garmin Integrated Flight Deck.
4. Press the FMS knob to activate the cursor.
5. Using the FMS knob navigate to the System Upload page.
6. Select "GRS MAG VAR DB" in the AIRFRAME field.

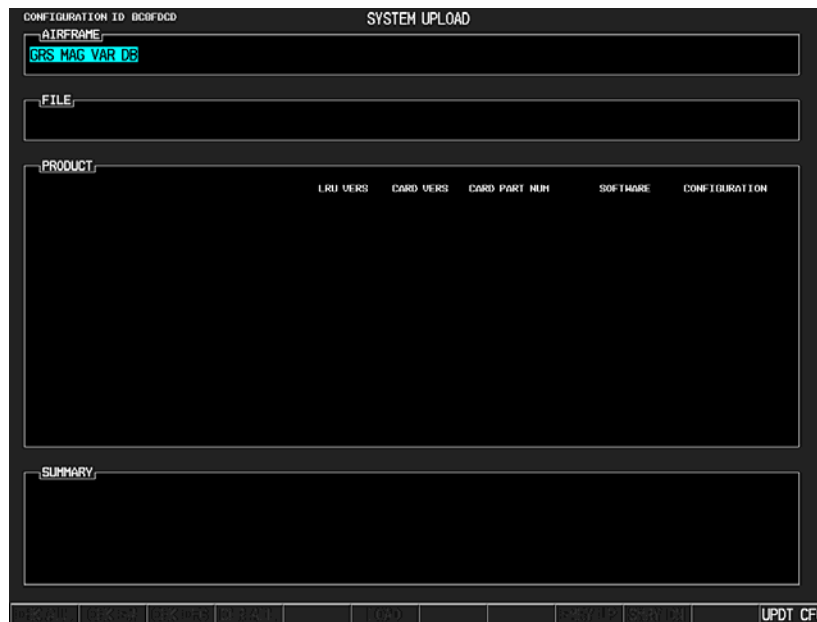

7. Press the ENT key.

8. Select "GRS Magnetic Variance Database Upload" in the FILE field.

CONFIGURATION ID: 01637F79 SYSTEM UPLOAD

AIRFRAME:
GRS MAG VAR DB

FILE:
GRS77 Magnetic Variance Database Upload

PRODUCT:

LRU VERS	CARD VERS	CARD PART NUM	SOFTWARE	CONFIGURATION
----------	-----------	---------------	----------	---------------

SUMMARY:

UPDT CFG

9. Press the ENT key.

10. If IGRF Part Number is 006-D0159-01 and Version is 2005.00 continue to step #11.

If IGRF Part Number is 006-D0159-02 and Version is 2010.00, do not continue this procedure.

11. Ensure all installed GRS entries are selected.

CONFIGURATION ID: 000FDC0 SYSTEM UPLOAD

AIRFRAME:
GRS MAG VAR DB

FILE:
GRS77 Magnetic Variance Database Upload

PRODUCT:


LRU VERS	CARD VERS	CARD PART NUM	SOFTWARE	CONFIGURATION
GRS1 MAG VAR DB	2005.00	2010.00	006-D0159-02	<input checked="" type="checkbox"/> N/A
GRS2 MAG VAR DB	2005.00	2010.00	006-D0159-02	<input checked="" type="checkbox"/> N/A

SUMMARY:


CHK ALL CHK SH CHK CFG CLR ALL LOAD UPDT CFG

Selected
GRS Entries


12. Press the LOAD softkey.
13. Monitor the upload status as it progresses.

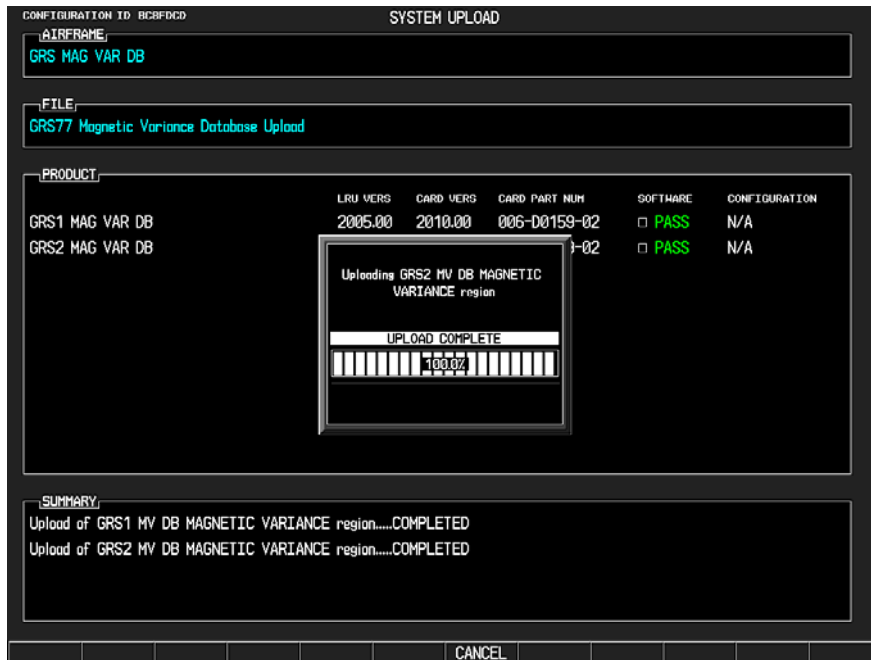

14. Select "OK" at the Upload Complete prompt.

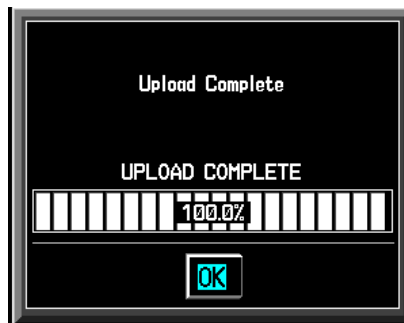

15. Verify all GRS LRU VERS fields indicate 2010.00.

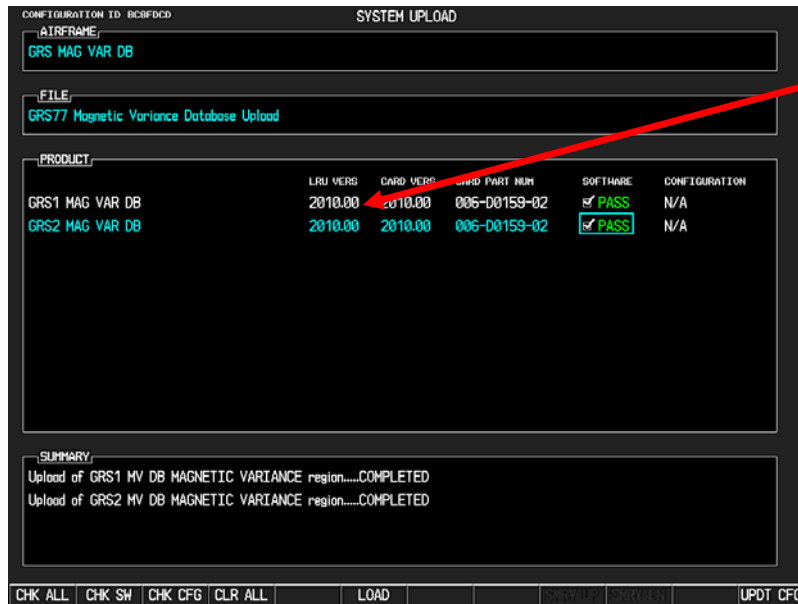

TESTING PROCEDURE

None.

MATERIAL INFORMATION

QTY	Part Number	Description
1	010-00987-00	2010 IGRF Magnetic Field Model

The 2010 IGRF Magnetic Field Model can be downloaded from the dealers only portion of www.garmin.com.